









» Specification Table » Installation Instructions » Features » Drawing



Mounting | Side mount. Side Clearance | 0.5"(12.70 mm) + 1/32" minus 0

each side. Height | 1.36"(34.5 mm)


Loading | 75 pound (35 kgs) class.

Features

Size | 250 mm through 700 mm at 50 mm increment. Feature | 32 mm hole pattern, quick release trigger for drawer removal, anti-rebound bumper, and breathing tab for self-adjustment.

Option | None.

■ Profile



■ Surface Treatment


- Clear Zinc
- Black Zinc
- Black E. Coating ■ Stainless Steel
- White E Coating ■ Galvanized Steel


Packaging

- Distribution / 30 pairs per box
- Production

*Box QTY might vary with different length, the info provided here is based on 18" (450 mm)

Drawing

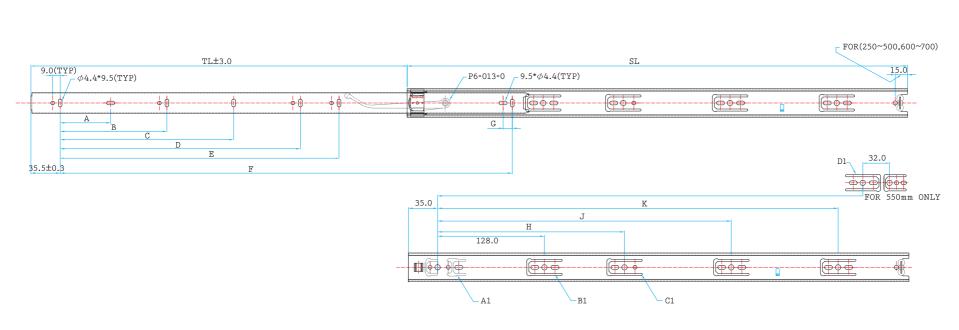



■ Profile


Specification Table

SIZE		SL	TL	А	В	С	D	Е	F	G	Н	J	K
10"	(250mm)	250.0	163.0						192.0				
12"	(300mm)	300.0	205.0	60.5					242.0	11.0	224.0		
14"	(350mm)	350.0	260.0	60.5	128.0				292.0	11.0	224.0		
16"	(400mm)	400.0	281.0	60.5	128.0				342.0	11.0	224.0	320.0	
18"	(450mm)	450.0	331.0	60.5	128.0	192.0			392.0	11.0	224.0	352.0	
20"	(500mm)	500.0	376.0	60.5	128.0	224.0			442.0	11.0	224.0	416.0	
22"	(550mm)	550.0	415.0	60.5	128.0	224.0	288.0		492.0	11.0	224.0	352.0	
24"	(600mm)	600.0	451.0	60.5	128.0	224.0	320.0		542.0	11.0	224.0	352.0	480.0
26"	(650mm)	650.0	488.0	60.5	128.0	224.0	320.0	544.0	592.0	11.0	224.0	352.0	544.0
28"	(700mm)	700.0	526.0	60.5	128.0	224.0	288.0	384.0	642.0	11.0	224.0	352.0	544.0


Installation Instructions

QUICK INSTALLATION GUIDE OF NJ-41K07


Loading, Single Extension Slides, 75 pound (35 kgs) loading

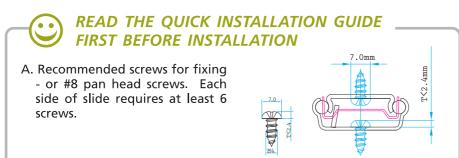


Technical Specifications for drawer or pull-out shelf

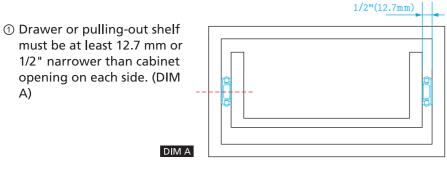


- ② Bottom of drawer or pulling-out shelf bottom shall have 6.4 mm or 1/4" minimum clearance from the bottom of cabinet. (DIM B)
- ③ Mark a center line from the bottom of cabinet with the proper height (H).
- 4 Mark a center line from the bottom of drawer with the proper height (

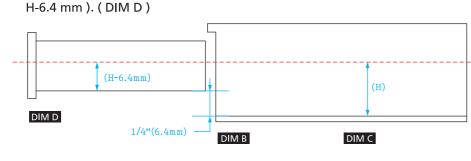

Step 1 > Install cabinet member to cabinet

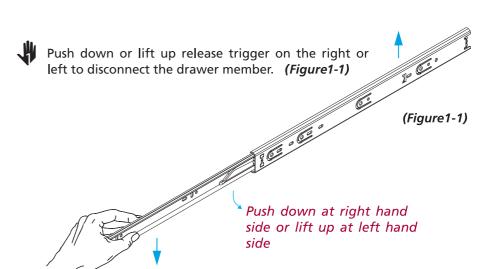

Align the center line of cabinet member to the determined line (H), and place slide 2 mm backward from cabinet opening. (Figure1-2)

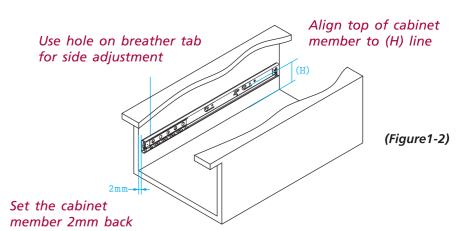


Fix the slides through the most flexible holes on breather tab for best slide performance. Leave the screw loose for final adjustment. Move the slides back and forth, and make sure no screw is bound.

Step 2 > Install drawer member to drawer

Align the center line of drawer member to the determined line (H-6.4 mm), and place drawer member 2 mm backward from the drawer front or the pulling-out shelf edge. (Figure2-1)

Shall the silencing cushion is used, place drawer member 5.2 mm backward.

Fix the drawer member through vertical slots for vertical adjustment. Leave the screw loose for final adjustment.

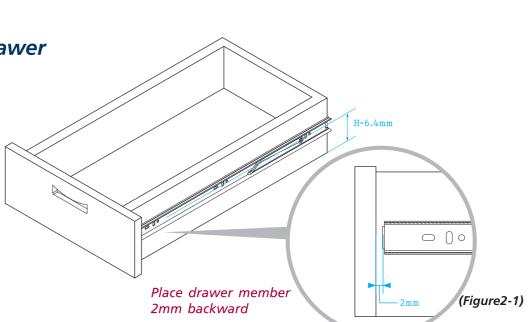

Step 3 > Insert drawer into cabinet

Make sure the bearing retainers are fully forward. Insert drawer member into the cabinet member, and then close the drawer completely.

Final Adjustment......

Try to open and close the drawer to see if slides function correctly. If so, secure the screws and install additional screws as necessary. If not, please make adjustment till slides function correctly.

*This instruction is for reference only. It may vary due to different applications.

